

# Work Order ID 119541

\*119541\*

Page 1

Friday, May 16, 2014 1:07:20 PM

Item ID: D212-664-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Fwd Crosstube - High

Start Date: 5/15/14 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 5/15/14 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: MLS Date: 14-05-22 Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D212-664-141	Rev D (DEO)

100	Document Control	0.00							
	DOCUMENT CONTROL								

\*100\*

DC

Doc.Control -USB or Paperwork

Memo

Photocopy bluefile and create labels as per PPP D212-664-101 CHG001/6

DAS  
06  
9-89

JUN 17 2014

110	Pick Kit	0.00							
	Packaging								

\*110\*

Packaging

Packaging

Memo

0.00

JW 14-06-02

120	BENDING MACHINE - CROSSTUBES	0.00							
-----	------------------------------	------	--	--	--	--	--	--	--

\*120\*

CNC Bend 2

CNC Alpha 160 Bender

Memo

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

0.00

JW 14-06-02

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>-Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	-Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	-Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	-Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence  <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---

**Work Order ID 119541**

Friday, May 16, 2014 1:07:20 PM

**\*119541\***

Page 2

Item ID: D212-664-101

Revision ID:

Item Name: Ewd Crosstube - High

Start Date: 5/15/14 Start Qty: 1.00

Required Date: 5/15/14 Req'd Qty: 1.00

Reference:

Accept

**\*N900040100\***Setup Start **\*NS1\***Stop **\*NS2\***

Cust Item ID:

Customer:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

QC15- Crosstube Dimensional Check

0.00

**\*130\***

QC

Memo

0.00

Quality Control

DAS  
03  
9-88

14-6-3

140

Crosstubes

0.00

**\*140\***

Crosstubes

Memo

0.00

Crosstubes

1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSL10

2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141

4-\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE \*\*\* Deburr & Inspect for surface damage. Repair damage within limits as per D212-664-141

14-06-03

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 119541

**\*119541\***

Page 3

Friday, May 16, 2014 1:07:20 PM

Item ID: D212-664-101 Accept **\*N900040100\*** Setup Start **\*NS1\***  
Revision ID: Stop **\*NS2\***  
Item Name: Fwd Crosstube - High  
Start Date: 5/15/14 Start Qty: 1.00 **\*1\*** Cust Item ID:  
Required Date: 5/15/14 Req'd Qty: 1.00 **\*1\*** Customer:  
Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150	QC5- Inspect part completeness to step on W/O	0.00	DAS	27					
<b>*150*</b>			9-89						
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
									JUN 05 2014
160		0.00							
<b>*160*</b>									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- CLEAN CROSSTUBE WITH WASH'N WIPE								
170	Outsource process - NDT per QSI038 4.1	0.00							
<b>*170*</b>									
Outsource2	Memo	0.00							
Outsource process - NDT	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Liquid Penetrant Inspection as per QSI 038								
	Issue P/O: <u>24484</u>								
	LPI as per ASTM 1417 Level 2								
	Attach copy of NDT results to work order								

1 0 0 AR  
14-6-5  
C214106105

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

**Work Order ID 119541****\*119541\***

Page 4

Friday, May 16, 2014 1:07:20 PM

Item ID: D212-664-101

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Fwd Crosstube - High

Start Date: 5/15/14 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 5/15/14 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180

Receive & Inspect for Damage & Mat'l Certs  
Packaging

0.00

**\*180\***

Packaging

Memo

0.00

Packaging

Ensure copy of NDT results attached to work order.

190

QC5- Inspect part completeness to step on W/O

0.00

**\*190\***

QC

Memo

0.00

Quality Control

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

Inspect for damage &amp; ensure results are as per Dwg D212-664-141

DAS  
27  
p-89

193

Crosstubes Chemical Conversion

0.00

**\*193\***

HandFXtube

Memo

0.00

Hand.Finishing Crosstubes

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN  
CROSSTUBE BEFORE CHEMICAL CONVERSION

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	--	---	--



**Work Order ID 119541****\*119541\***

Page 5

Friday, May 16, 2014 1:07:20 PM

Item ID: D212-664-101

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Fwd Crosstube - High

Start Date: 5/15/14 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 5/15/14 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursTool ID Tool # Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

195

QC7-Inspect Chemical Conversion Coat

0.00

**\*105\***

QC

Memo

0.00

Quality Control

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

1	0	0	DAS 41 9-89 14-6-6
---	---	---	-----------------------------

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Prep									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

**Work Order ID 119541****\*119541\***

Page 6

Friday, May 16, 2014 1:07:20 PM

Item ID: D212-664-101

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Stop

**\*NS2\***

Item Name: Fwd Crosstube - High

Start Date: 5/15/14 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 5/15/14 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

**\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

**\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

200

Spray Painting per QSI005 4.2  
SprayPaint

0.00

**\*200\***

SprayPaint

Memo

0.00

Spray Painting

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

1-Prime inside and outside crosstube as per QSI 005 4.2

PRIME BATCH: 128826Start Time: 12:30Finish Time: 1:15

AG 14-6-6

\*\*\*MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG DEO\*\*\*

2-Paint outside crosstube with White Imron as per QSI 005 4.2

PAINT BATCH: 129174Start Time: 7:00Finish Time: 8:00

3- Remove masking and apply matte clear coat as per dwg DEO

CLEAR BATCH: 128764

AG 14-6-6

1 CR 14-06-08

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 119541

\*119541\*

Page 7

Friday, May 16, 2014 1:07:20 PM

Item ID: D212-664-101 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Fwd Crosstube - High  
 Start Date: 5/15/14 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 5/15/14 Req'd Qty: 1.00 \*1\* Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start \*NR1\*  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	QC14- Inspect Spray Paint	0.00	DAS						
*210*			27						
QC	Memo	0.00	\$-89						
Quality Control	Then, Wrap in plastic bag to protect from scratches		4/6/12						
220		0.00							
*220*	Crosstubes								
Crosstubes	Memo	0.00							
Crosstubes	1-Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg								
	2-Install supports with Proseal 890 per D212-664-141 (DEO) and QSI 015								
	A/R Proseal 890 Batch: 128 638								
	EXP: 10/1/14								
	3-Install supports clamps Using Dt9565 as per Dwg D212-664-141 (DEO), Torque to 80-100 IN-LBS.								
	PROSEAL CURE TIME 72 HOURS:								
	Start: 14-06-08								
	Finish: 14-06-11								

1 CR 14-06-08

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 119541

\*119541\*

Page 8

Friday, May 16, 2014 1:07:20 PM

Item ID: D212-664-101 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Fwd Crosstube - High  
 Start Date: 5/15/14 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 5/15/14 Req'd Qty: 1.00 \*1\* Customer:

## Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start \*NR1\*  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

230

QC5- Inspect part completeness to step on W/O

0.00

\*230\*

QC

Quality Control

Memo

\*\*\*RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED  
 FOR 72HOURS AS PER DWG.\*\*\*

0.00

240

Pick Kit

0.00

\*240\*

Packaging

Packaging

Memo

0.00

250

QC4- 100% Inspect kits for completeness

0.00

\*250\*

QC

Quality Control

Memo

0.00

1/X DAS 28 9-89 JUN 13 2014  
 DAS 31 9-89  
 DAS 06 9-89 JUN 17 2014  
 M. R.

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other  _____ _____ _____
--	--	---	---



**Work Order ID 119541****\*119541\***

Page 9

Friday, May 16, 2014 1:07:20 PM

Item ID: D212-664-101

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Fwd Crosstube - High

Start Date: 5/15/14 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 5/15/14 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

260

0.00

**\*260\***

Packaging

Packaging

Memo

0.00


094

DAS  
06  
9-89

Packaging

Identify and pack for shipping as per PPP D212-664-101

JUN 17 2014

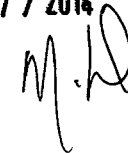

270

0.00

**\*270\***

QC

QC21- Final Inspection - Work Order Release

Memo

0.00

Quality Control

14/6/18



DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

Friday, May 16, 2014 1:07:23 PM

Page 1

Work Order ID: 119541

**\*119541\***

Parent Item: D212-664-101

**\*D212-664-101\***

Parent Item Name: Fwd Crosstube - High

Start Date: 5/15/14

Required Date: 5/15/14

Start Qty: 1.00

Required Qty: 1.00

## Comments:

IPP Rev:E04.02.16ReformatKJ/DS

IPP Rev:F 06-03-29 Remove Coments on Pick List JLM

IPP Rev:G 07-04-30 As per Rev C JLM IPP Rev:H

11.04.26 inspection strip ecn 11-549 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664-101TRN		Manufactured	No	B119867		110	Each	0.0000	1	1		JW 14-06-02	
<b>*D212-664-101TRN*</b>									<b>**</b>				
Crosstube Turning Detail													
D3595-063-450		Manufactured	No			230	Each	318.0000	4	4			
<b>*D3595-063-450*</b>									<b>**</b>			CR 14-06-08	
Rubber Cushion													

Location	Loc Qty	Loc Code
FG	15	
88422	5	
94274	10	
LG	100	
115083	100	
LG050	4	
118828	4	
LG051	199	
109526	2	
115271	4	
116587	42	
117650	151	

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

Friday, May 16, 2014 1:07:23 PM

Work Order ID: 119541

**\*119541\***

Parent Item: D212-664-101

**\*D212-664-101\***

Parent Item Name: Fwd Crosstube - High

Start Date: 5/15/14

Required Date: 5/15/14

Start Qty: 1.00

Required Qty: 1.00

MS21920-25

Purchased

No

220

Each

65.0000

4

4

**\*MS21920-25\***

**\*\***

*CR 14-06-08*

Clamp

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	2	
120920	2	
LG	9	
M128994	9	
LG050	51	
M128012	1	
M128701	25	<u>4</u>
M128718	25	
Return2014	3	
128012	3	

D2893-1

Manufactured

No

220

Each

11.0000

2

2

**\*D2893-1\***

**\*\***

*CR 14-06-08*

Support

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	2	
87289	2	
LG051	2	
118827	2	
LG052	7	
102854	1	
110724	6	

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____
--	--	---	---

# Picklist Print

Friday, May 16, 2014 1:07:23 PM

Work Order ID: 119541

**\*119541\***

Parent Item: D212-664-101

**\*D212-664-101\***

Parent Item Name: Fwd Crosstube - High

Start Date: 5/15/14

Required Date: 5/15/14

Start Qty: 1.00

Required Qty: 1.00

D3428-1      Manufactured      No      240      Each      17.0000      1      1

**\*D3428-1\***

Placard

DAS  
06  
9-89

\*\*

DAS  
28  
9-89

JUN 13 2014

Location	Loc Qty	Loc Code
ST042	17	
107703	1	
112604	12	
115887	4	

1x

DAS  
31  
9-89

AN6-35A      Purchased      No      240      Each      62.0000      4      4

**\*AN6-35A\***

BOLT

DAS  
06  
9-89

\*\*

DAS  
28  
9-89

DAS  
31  
9-89

Location	Loc Qty	Loc Code
ST340	62	
m128300	12	
m128324	50	

4x

AN6-36A      Purchased      No      240      Each      121.0000      4      4

**\*AN6-36A\***

Bolt

DAS  
06  
9-89

\*\*

DAS  
28  
9-89

DAS  
31  
9-89

Location	Loc Qty	Loc Code
ST340	4	
M126474	2	
m127124	2	
ST504	117	
m127363	42	
M128403	75	

4x

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--



# Picklist Print

Page 4

Friday, May 16, 2014 1:07:24 PM

Work Order ID: 119541

**\*119541\***

Parent Item: D212-664-101

**\*D212-664-101\***

Parent Item Name: Fwd Crosstube - High

Start Date: 5/15/14

Required Date: 5/15/14

Start Qty: 1.00

Required Qty: 1.00

MS21042L6

Purchased

No

240

Each

365.0000

6

6

DAS

28  
9-89

JUN 13 2014

**\*MS21042L6\***

\*\*

Nut

DAS  
06  
9-89

Location

Loc Qty

Loc Code

ST314

365

m127831

23

m128635

342

240

Each

2,147.000

18

18

\*\*

DAS

28  
9-89

DAS  
31  
9-89

NAS1149D0663J

Purchased

No

**\*NAS1149D0663J\***

Washer

DAS  
06  
9-89

Location

Loc Qty

Loc Code

ST294

7

123265

4

M126284

3

ST510a

2140

M126334

699

M127813

35

M127916

406

M128818

1000

DAS  
31  
9-89

Friday, May 16, 2014 1:07:24 PM

Shop Packet Print

Page 4

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b> 119541	
<b>Description:</b> Crosstube High Fwd (205/212/412)		<b>Part Number:</b> D212-664-101	
<b>Inspection Dwg:</b> D212-664-141 <b>Rev:</b> D		<b>Page 1 of 1</b>	


Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7
Bending Passes	3	--
Crushing	--	6%

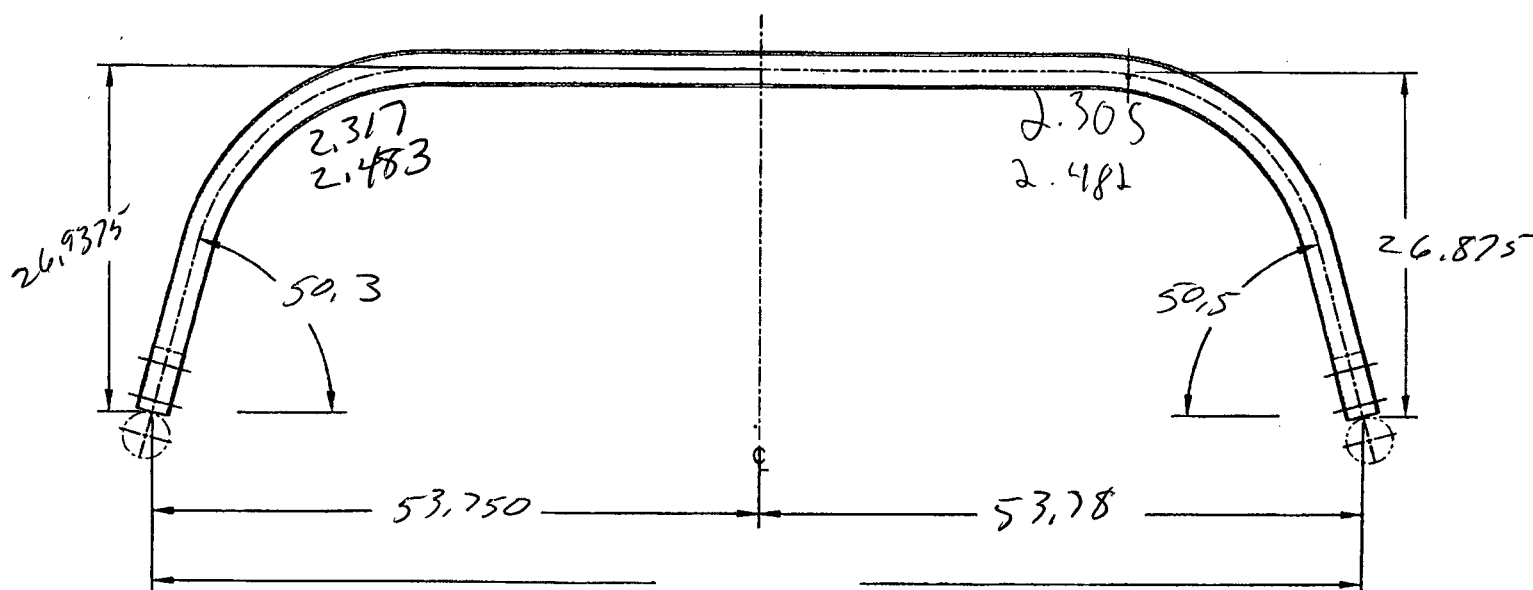

	Side A	Side B
Bending Passes	6	6
Crushing	3.5%	3.8%
Comments		

QC15 Inspection	
Date	

DAS  
03  
8-88

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	



Item	Qty -141	Qty -141B	Part Number	Description
1	X		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

#### GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6005-128  
FINISHED LENGTH = 126.514±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF  
USING VIBRATING STYLUS
- 7) WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)  
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS  
6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF  
D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER  
INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1  
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE  
SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE  
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR  
DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND  
MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT  
HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT

WITHOUT NOTICE  
WORK ORDER  
NO. 119541 ML5


14-05-22

REMOVED FROM UNDER REVIEW 922  
UNDER REVIEW EGN 11-614  
14-10-13  
FOR PRO-SEALING TUBES  
21.07.26


DEO ATTACHED

RELEASED  
2009-10-29

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE, TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-141	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

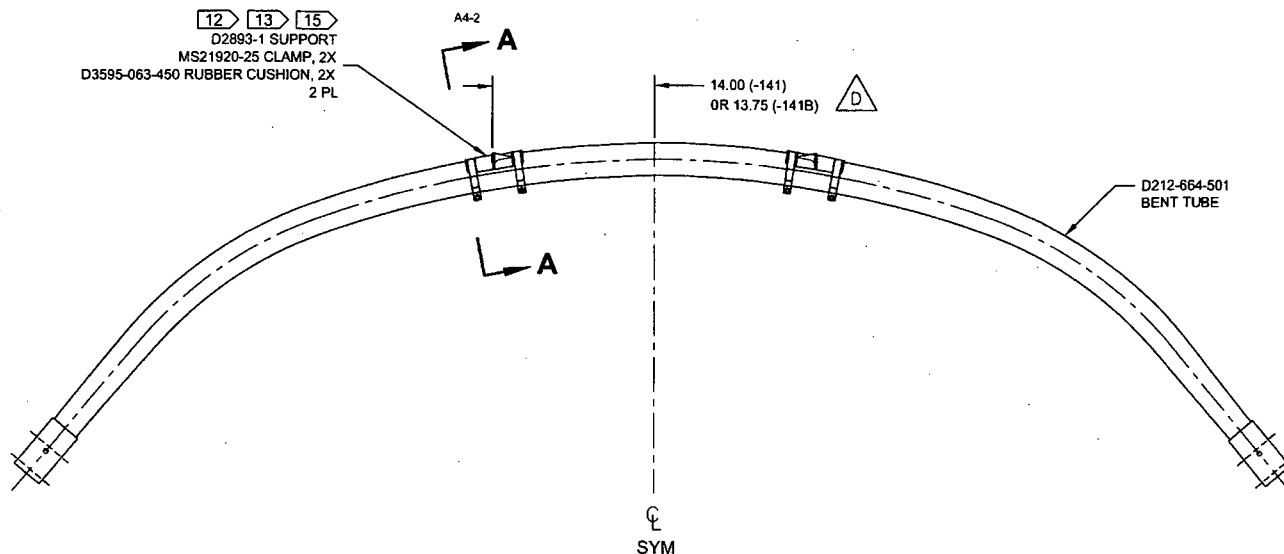

**D212-664-141/-141B  
ASSEMBLY DETAIL**

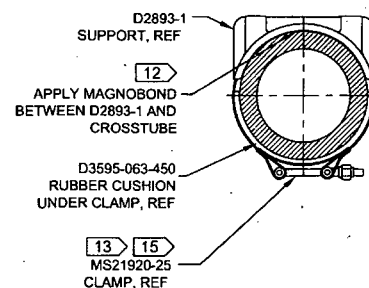


**SECTION A-A**  
SCALE 4X

ECN#K-614  
1.07.20  
**UNDER REVIEW**  
11.9.23

**DEO ATTACHED**  
**RELEASED**  
2009-10-29

DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	97	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 2 OF 4
APPROVED	110	TITLE	SCALE
DE APPR.	11	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS COVENANT THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1

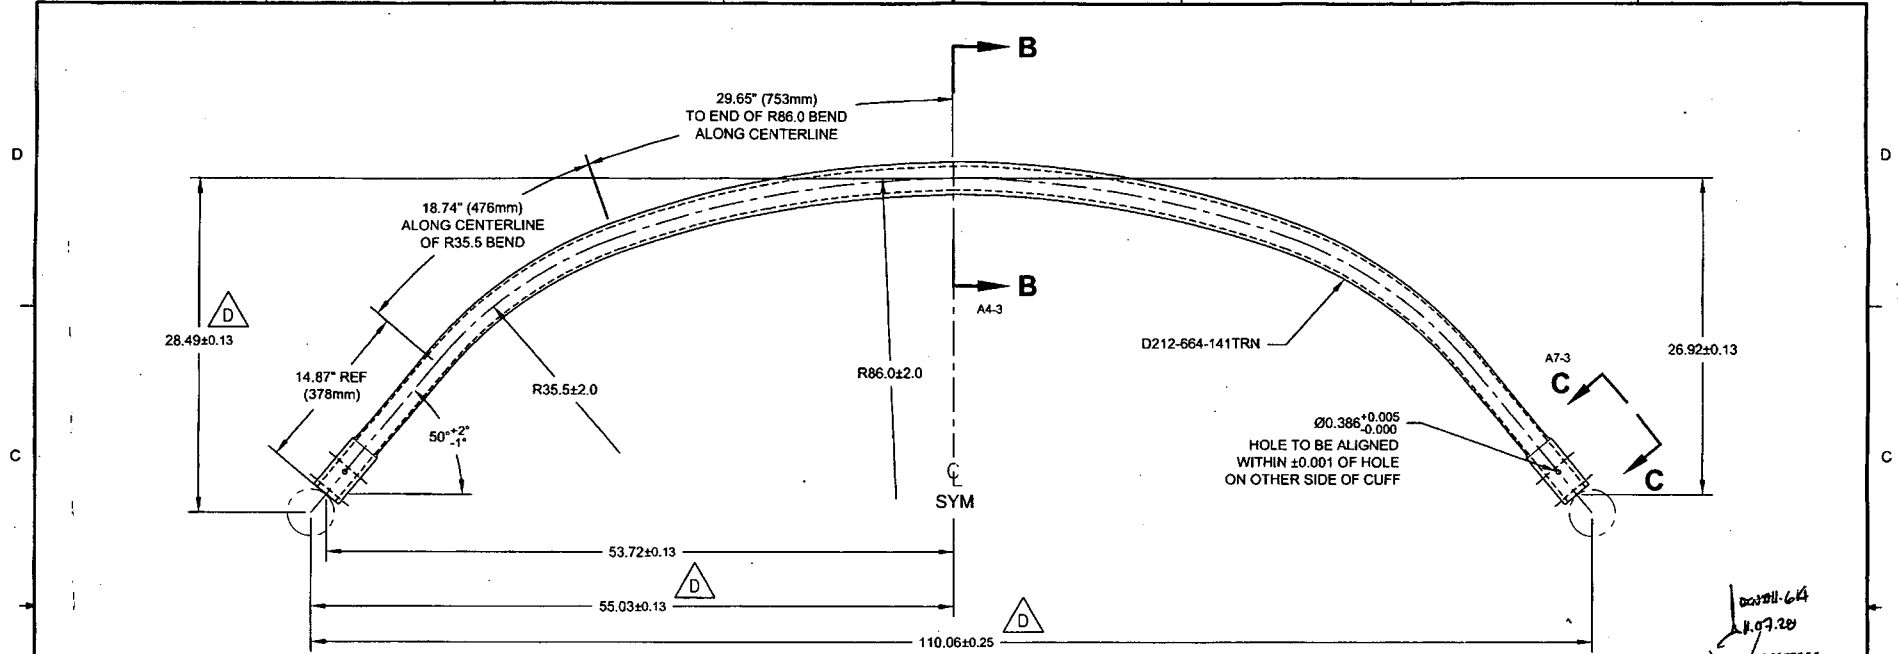


**D212-664-501**  
**BENDING AND DRILLING DETAIL**


UNDER REVIEW  
11.06.13

DEO ATTACHED

RELEASED  
2009-10-29

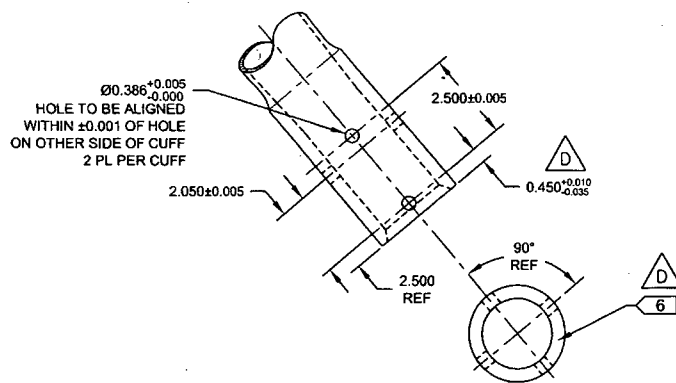



**VIEW C-C: CUFF DETAIL**  
SCALE 3X

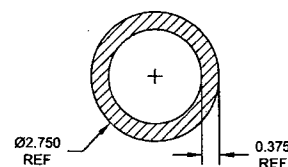

**SECTION B-B**  
SCALE 4X


DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	LS	D212-664-141	SHEET 3 OF 4
APPROVED	AD	TITLE	SCALE
DE APPR.	CH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2005 BY DART AEROSPACE LTD	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

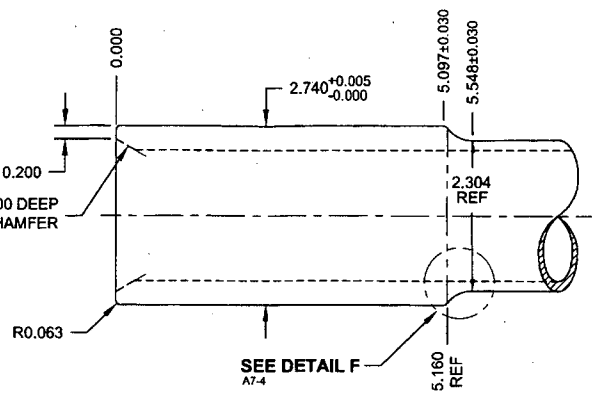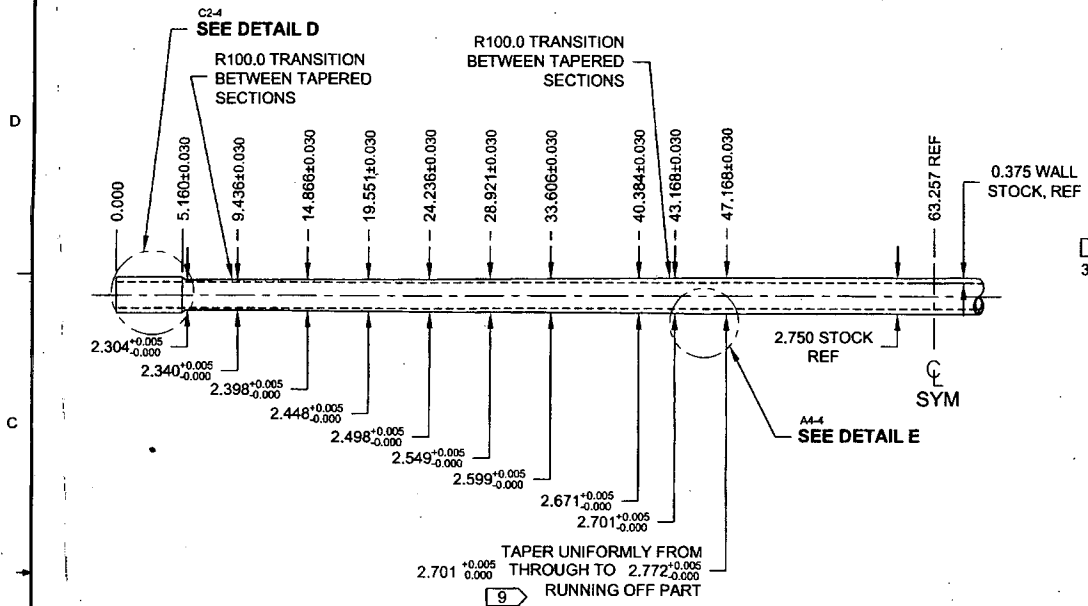


**DETAIL D: CROSSTUBE CUFF** D8-4  
 SCALE 5X

**D212-664-141TRN TURNING DETAIL**

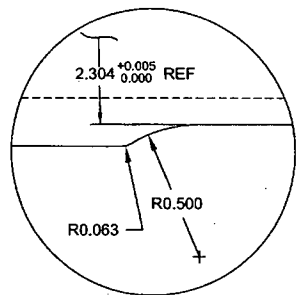

**DETAIL F: CUFF TRANSITION** C2-4  
 SCALE 10X

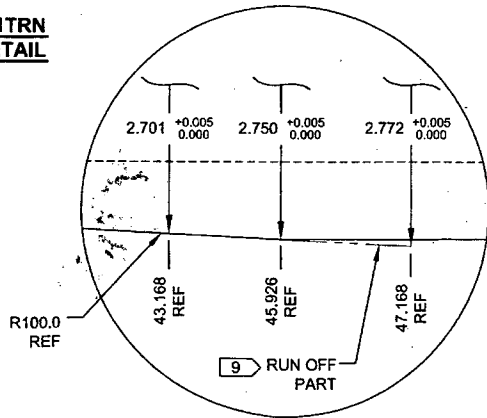

**DETAIL E: TAPER RUN-OFF** C5-4  
 NOT TO SCALE

**UNDER REVIEW**  
 11.06.13

**DEO ATTACHED**

**RELEASED**  
 2009 -10- 29  
 [Signature]

DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 4 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	11	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MP	MFG. APPR.	BE	APPROVED	MP	DE APPR.
DATE 11.04.07	DATE 11.07.11		DATE 11.04.12		DATE 11/04/12		DATE 11.04.12

**PURPOSE:**

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

**CHANGE:**

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND  
PAINT OUTSIDE PER DART QSI 005 4.2  
REMOVE MASKING AND APPLY CLEAR COAT

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2

**RELEASED**  
2011-04-18

**UNDER REVIEW**

14/06.13  
12/05.11-614  
12/11.07.28

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>	D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>UP</i>	MFG. APPR. <i>CE</i>	APPROVED <i>WAD</i>	DE APPR. <i>WAD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

**IS:**


**WAS:**

**UNDER REVIEW**


*UP 11/06/13*

*ECN # 11-614*

*11.07.28*

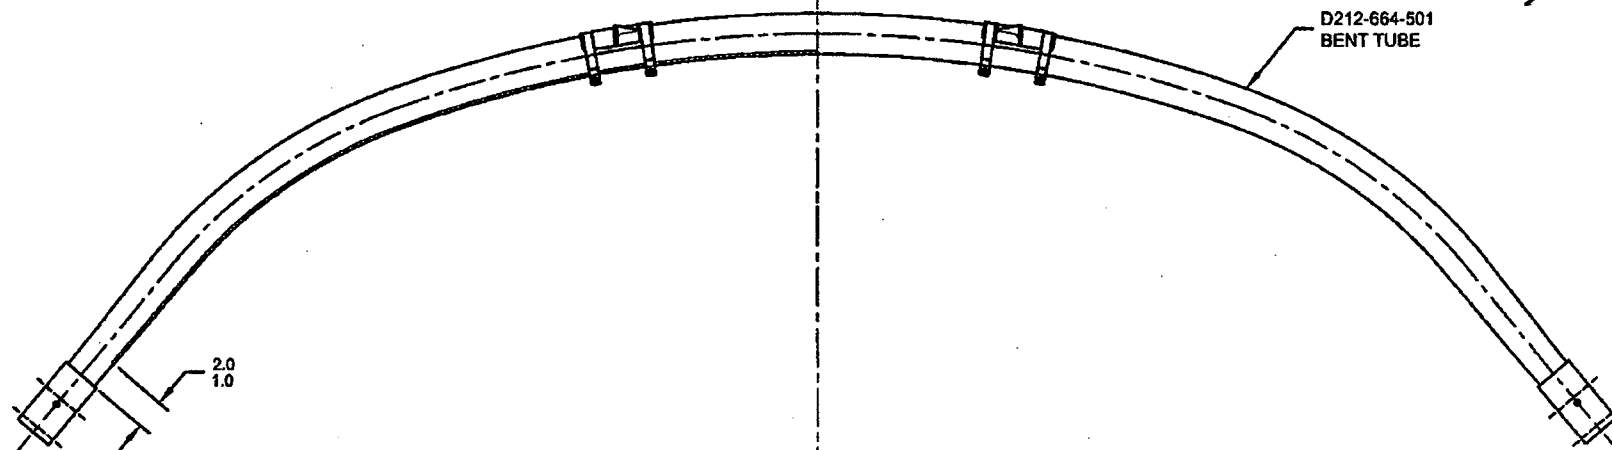

**D212-664-141/-141B**  
**ASSEMBLY DETAIL**

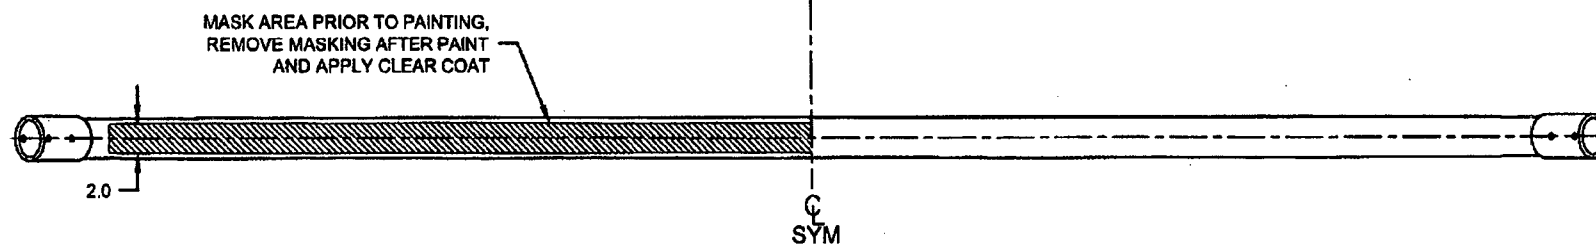

**COPYRIGHT © 2011 BY DART AEROSPACE LTD**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DRAWING NO. D212-664-141	TITLE CROSSTUBE ASS'Y (205 HI FWD)	REV. D	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>	D.E.O. NO. D212-664-141-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AB</i>	APPROVED <i>MD</i>	DE APPR. <i>TH</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21	DATE 11.07.21		

**PURPOSE:**

REPLACE MAGNOBOND WITH PROSEAL.

**CHANGE:**

IS:

Item	Qty -141	Qty -141B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 8398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2893-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 8398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED  
2011-07-28  
*MD*

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>		D.E.O. NO. D212-664-141-D-3	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN AJS	CHECKED 47	MFG. APPR. 140	APPROVED 140		DE APPR. 141		
DATE 12.06.28	DATE 12.07.05	DATE 12.07.05	DATE 12.07.05		DATE 12.07.05		

**PURPOSE:**

ADD NEW CONFIGURATION WITH ANODIZED FINISH

**ADD -141F CONFIGURATION TO PARTS LIST AS SHOWN BELOW:**

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
3	1	1	1	D6005-128	CROSSTUBE
4	2	2	2	D2893-1	SUPPORT
5	4	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

\*NOTE ITEM 7 HAS BEEN UPDATED IN ACCORDANCE WITH DEO D212-664-141-D-2

**AMEND NOTE 2 AS FOLLOWS:**

**IS:**

- 2) FINISH -141 & -141B ONLY: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1  
d) PAINT OUTSIDE PER DART QSI 005 4.2  
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT

- FINISH -141F: a) ANODIZE PER MIL-A-8625, TYPE II, CLASS 1.  
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2  
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1  
e) PAINT OUTSIDE PER DART QSI 005 4.2  
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT

**\*NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN  
NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.

**WAS:** (UPDATED PER DEO D212-664-141-D-1)

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1  
PAINT OUTSIDE PER DART QSI 005 4.2  
REMOVE MASKING AND APPLY CLEAR COAT

**RELEASED**  
2012-07-10  
47



## D212-664-101

### BATCH NUMBER:

**SET UP** - 2.75 Rollers x 3 w/1.6" shims  
2.875" in buggy A

TANGENT LINES from cuff @ 33.6, **36.46 RED**, then Centerline is @ 63.25

### MIDDLE BENDS

**Start bending @ 33.6** line with longest part of tube on small table. Appr is **2600** on bth Y&W.

Use program 212fMauto.

MATCH MIDDLE BEND TO OUTLINE ON REFERENCE BOARD slightly below line is acceptable. (no more than 0.030")

DO NOT underbend middle or you will have issues finishing tube

use middle fix program if not bent enough ..(mfix, mfix2)

If middle still is underbent modify 24" section of middle fix program and re-run.

### SIDE BENDS

**Start bending @ 36.46** line. with longest part of tube on large table **1500** appr on Y and **3735** on W. W stays @ this appr on all programs. Run 1-2-3 without stopping, then check, .

If tube isn't bent enough run 3aaa and up as required to finish. .checking between each program..

... **2000** for Y and **3735** for W..

### Notes:


- underbent midde by approx 0.060". was UNABLE to reach nominal dimensions. scrapped tube after rebending middle to achieve nominal dimensions. "midde fix after sides are bent" was over effective, it runs from centre line out. therefore. DO NOT underbend middles, and use caution if using "middle fix after sides are bent" program. jw 12/6/1

14/02/26.. Bent 4 tubes, (Ran 212fMauto, Mfix, Mfix2) middle finished even to outline on new board.

Side bends were prog.(1,2,3,3c..CHECK) ran 5,6 and up checking between each until finished (prog. 4 was skipped on all 4 tubes)

### Passes:

1	212fMauto	1
2	Mfix	2
3	Mfix2	3
3c		3c
<u>    </u>		<u>    </u>

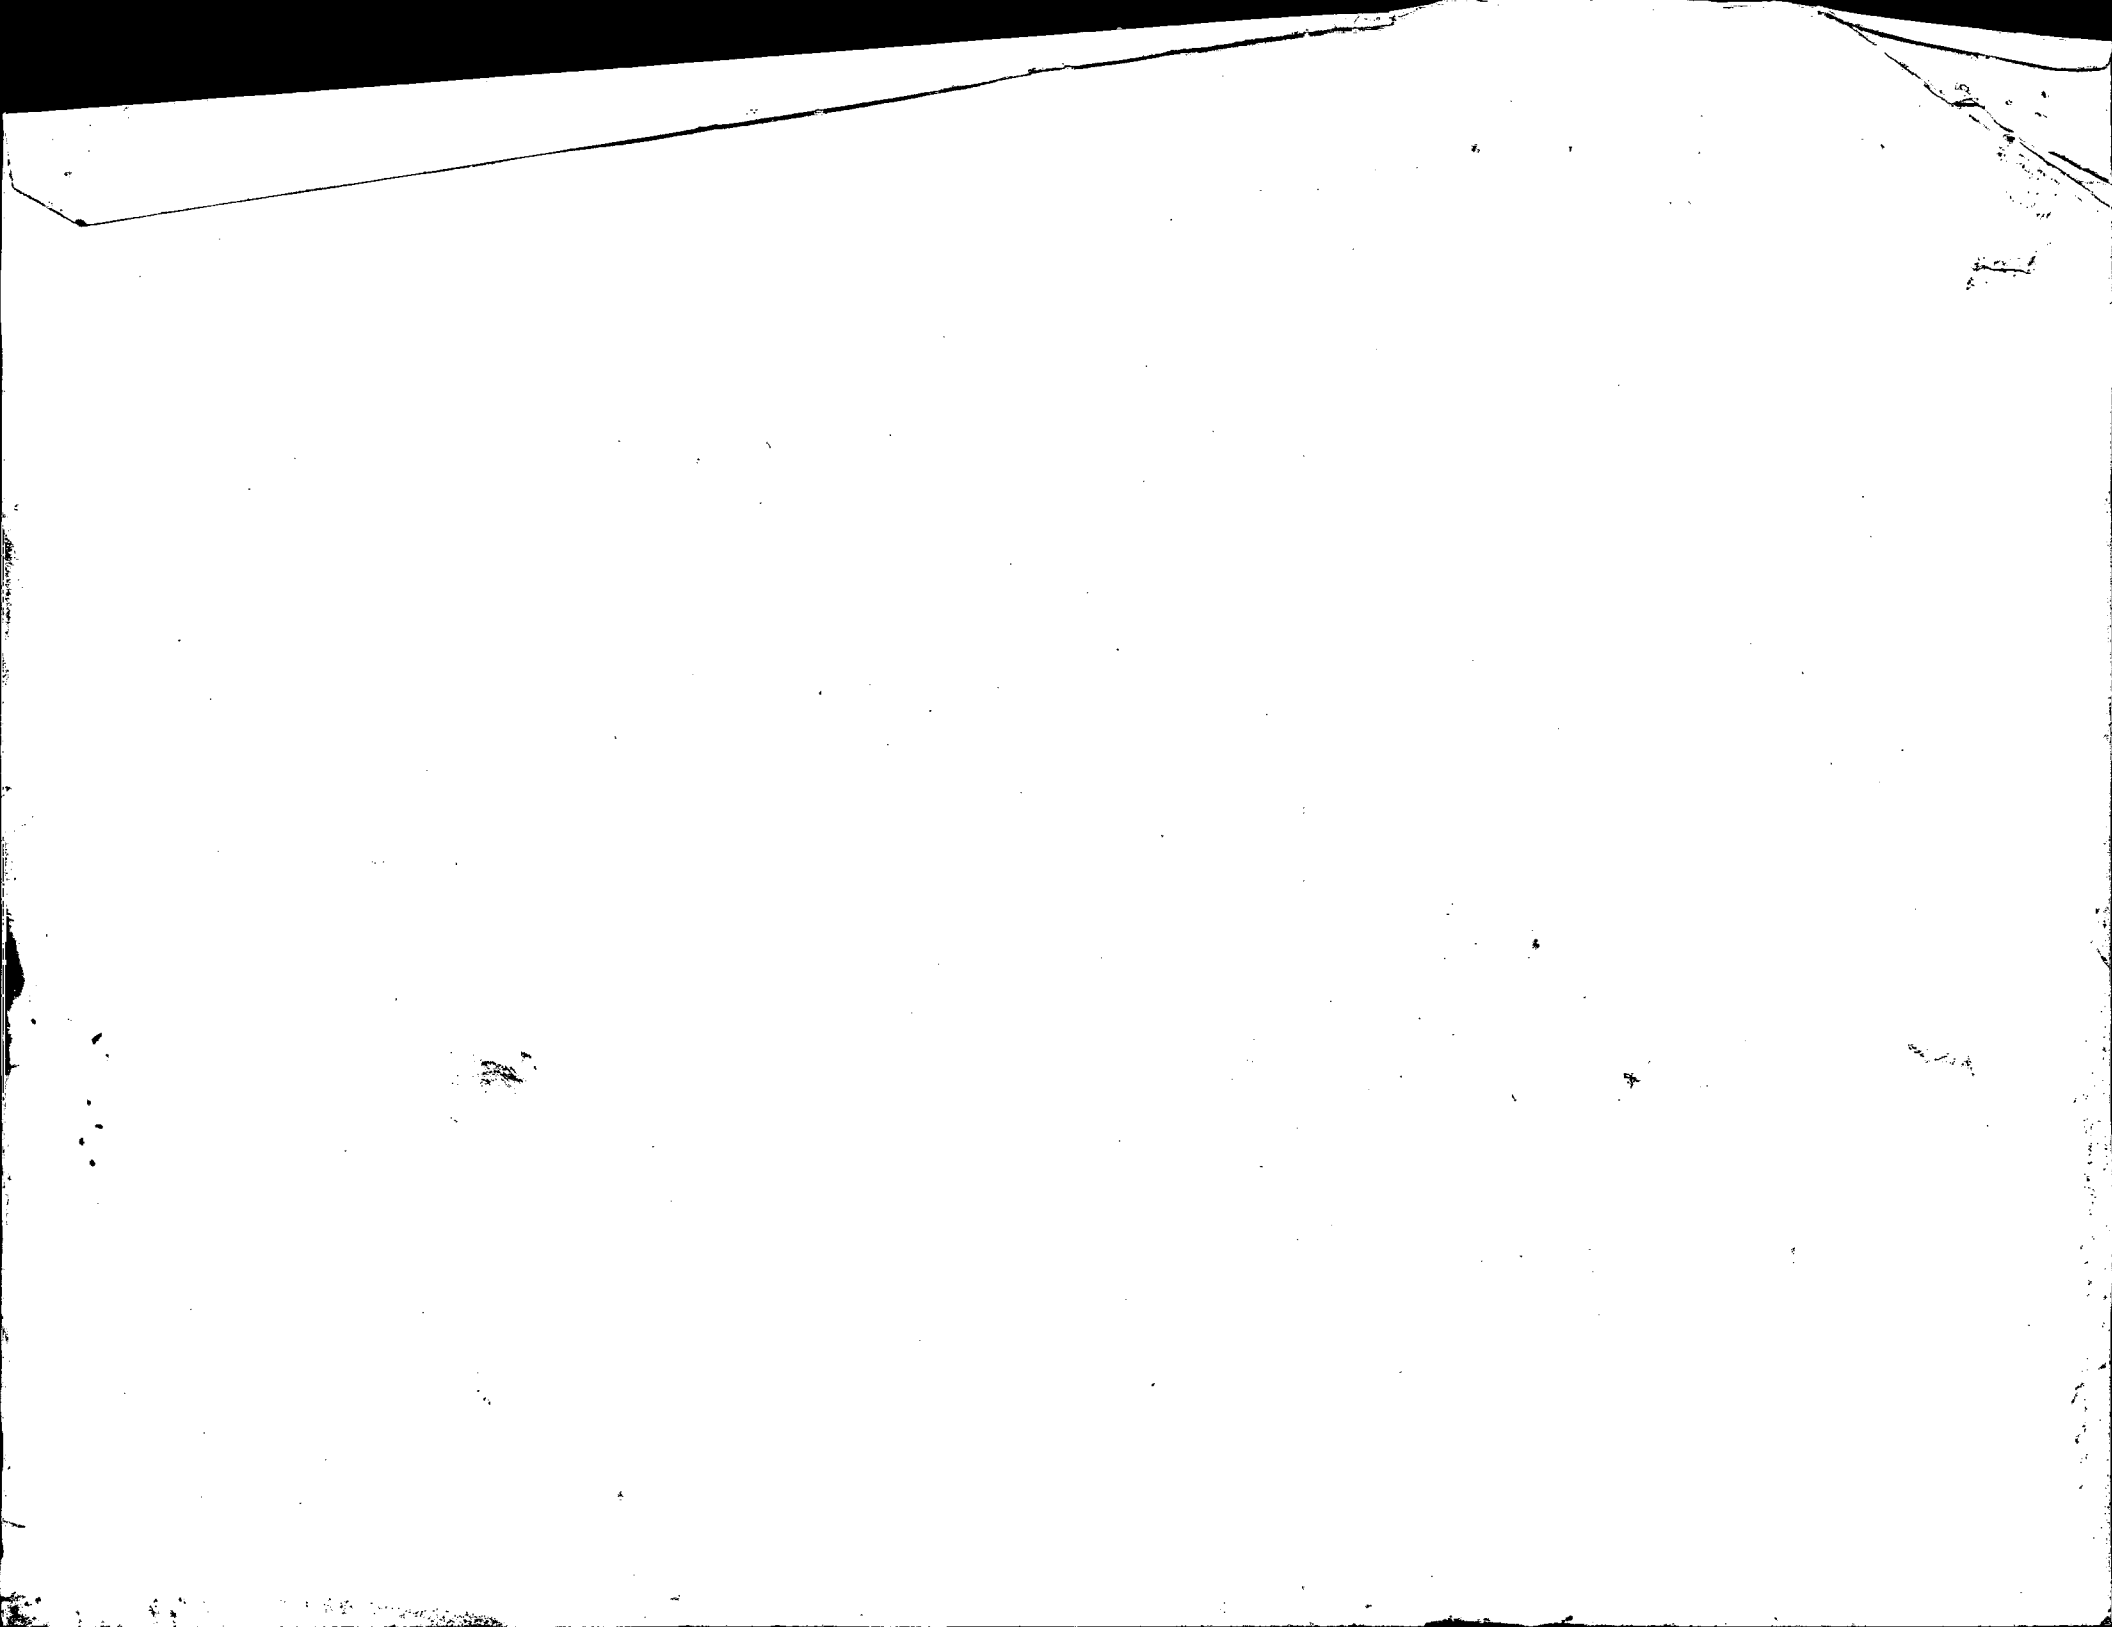



# skyservice

Air travel. Evolved.

## NDT Work Order

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA/AMO 385

WO #: YYZ

70275

Customer: DART AEROSPACE

Dept: NDT YYZ

Reference: 24484

Make:

Model:

Reg:

A/C S/N:

TSN:

CSN:

TSO:

Tail#:

Task: ☒ Scheduled ☐ Unscheduled ☐ A.O.G. ☒ X.P.T. ☐ M.T. ☐ E.T. ☐ U.T. ☐ R.T.

### Work Required:

① CARRY OUT NDT ON FOLLOWING AFT MID HEIGHT CROSSTUBES

ITEM ID: D206-667-207BL IAW ASTM E1417-M13

WORK ORDER ID'S = 114855; 114854; 114579; 114578

② CARRY OUT NDT ON FOLLOWING FWD CROSSTUBES

ITEM ID: D212-664-101 IAW ASTM E1417-M13

WORK ORDER ID'S = 119544; 119543; 119542; 119541

### Action Taken:

Date:

Initial/Stamp:

① LIQUID PENETRANT + EDDY CURRENT INSPECTIONS

CARRIED OUT ON AFT MID HEIGHT CROSSTUBES 05 JUN 2014

WD'S 114855, 114854, 114579; 114578

NO CRACKS FOUND

DAS

27

9-89

4/16/14



② LIQUID PENETRANT + EDDY CURRENT INSPECTIONS

CARRIED OUT ~~OUT~~ ON FWD CROSSTUBES 05 JUN 2014

WD'S 119544, 119543, 119542, 119541

NO CRACKS FOUND



PENETRANT - ARDROX 970 P25E BATCH

02312131

ET - NORTEC 500S SNT-20656 CAL DUE

30 JAN 2015

I certified that the maintenance described above has been performed with the applicable standard of airworthiness.

Signature:

Name:

GARY SMITH

ACA/SCA Stamp



Date:

05 JUN 2014

Work Order ID 119541

Friday, May 16, 2014 1:07:20 PM

\*119541\*

Page 1

Item ID: D212-664-101 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Fwd Crosstube - High  
 Start Date: 5/15/14 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 5/15/14 Req'd Qty: 1.00 \*1\* Customer:  
 Reference:

Approvals: Process Plan: MLJ Date: 14-05-22 Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_  
 Run Start \*NR1\*  
 Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D212-664-141	Rev D (DEO)								
100	Document Control	0.00							
*100*	DOCUMENT CONTROL								
DC	Memo	0.00							
Doc.Control -USB or Paperwork	Photocopy bluefile and create labels as per PPP D212-664-101 CH0005								
110	Pick Kit	0.00							
*110*	Packaging								
Packaging	Memo	0.00							
Packaging									
120		0.00							
*120*	BENDING MACHINE - CROSSTUBES								
CNC Bend 2	Memo	0.00							
CNC Alpha 160 Bender	Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101								

CH0005  
 off 006 see attachment

14-06-02

14-06-02



